


QUICK CONFIGURATION GUIDE

Connection

Connect the “K printer cable” (Ref. 32294) to the weight indicator and to the printer.

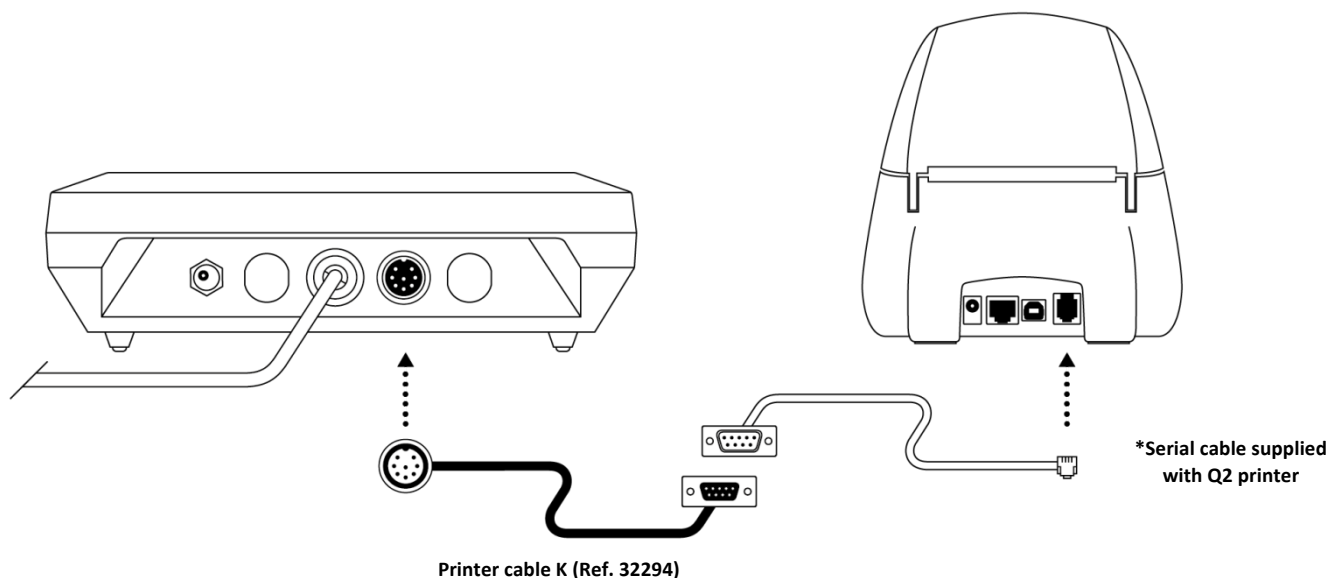

Step 1: Configure the K3 weight indicator for use with the Q2 printer

The K3 indicator is factory-configured for using a PR4 model printer. To obtain full performance from your **Q2 printer**, you need to first change this configuration before its use, following the indications contained in this document. Once this procedure has been completed, the configuration is registered in the unit's non-volatile memory and it will not be necessary to repeat it.

1. Long press of the **[PLU/M]** key to access the configuration options menu.
2. The **RF** menu appears
3. Press the **←** key to move to the **5232** menu option
4. Press the Enter key to validate, the display will show the option **brud**
5. Press the **←** key to move to the **000 1** menu item
6. Press the Enter key to validate, the display will show the option **5-000 1**
7. Press the **←** key to move to the **F000 1** menu item
8. Press the Enter key to validate, the display will show **PR4**
9. Press the **←** key to move to the menu item **Q2**
10. Press the **↵** key to validate, **SRUE** will appear and you will return to the **F000 1**
11. Press the **Esc** key (**U**) three times to exit the setup menus.
12. Setup is complete.

003/19072021

